



MANUFACTURING, INC.

## **EZ Hauler 3500/3800/4100 Product Announcement**

**Subject:** Sealing module connectors

**Date:** June 8, 2006


**To:** EZ Hauler 3500/3800/4100 Owners      **Announcement:** CCG1963

**From:** SDP Product Support

**Phone:** 765-768-5000

**EZ Hauler models 3500/3800/4100 manufactured prior to March 12, 2008 could experience hydraulic module failure. Failure to update could result in total hydraulic module failure!**

**This is a mandatory update. First locate the remote wiring harness at the top of crane valve. To do this update, pull connector shell of remote harness apart from module connector & place a “thumbnail size” of dielectric grease inside, then reconnect the harness to the module. You will then need to seal the backside of the remote wiring harness with silicone. This fix will prevent water from entering the connectors & disrupting the function of the remote control.**

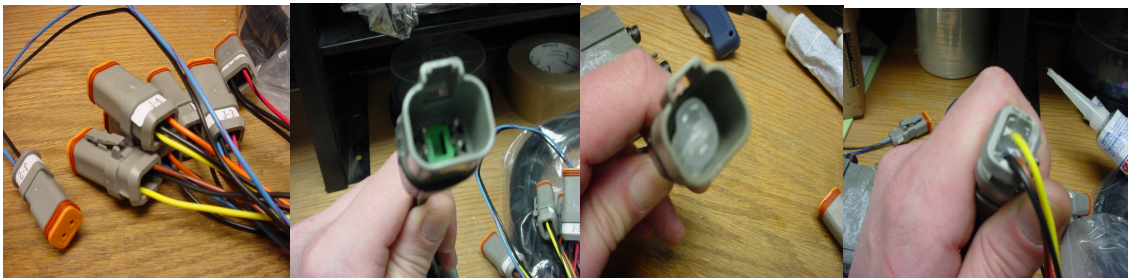

**SDP Manufacturing, Inc.**

400 Industrial Drive

Dunkirk, IN 47336

Tel: 765-768-5000 Fax: 765-768-5015

**Announcement #:** CCG1963

Print Date: 3/12/2008